



Technical Service Bulletin

No.LTB00129
17
March 2008

Subject/Concern: B-Pillar Trim Panel Wear

Models:
Freelander 2 | VIN- range: H000201-H009353

Markets: All
Section: 501-00

Summary:
Excessive wear on the B-Pillar interior trim panel.

Cause: The safety belt contacts the B-Pillar trim during normal use causing wear.
Suggested Customer Concern Code - T53.

Action: Should a customer express concern, follow the Service Instruction outlined below.

Parts Required:		
Description	Part Number	Quantity
Upper B-Pillar trim panel - Right-Hand (RH) side	LR006439	1
Upper B-Pillar trim panel - Left-Hand (LH) side	LR006440	1
Safety belt - Front RH - NAS only	LR006921	1
Safety belt - Front RH - ROW	LR006920	1
Safety belt - Front LH - NAS and ROW	LR006922	1

Labour Time:		
Operation Description	Operation No.	Time
Safety belts - Front - Set - Renew	76.73.11	0.6 hours
Upper B-Pillar trim panel - Renew	76.13.28	0.3 hours

Repair/Claim Coding:	
Causal Part:	RHS-LR006439 - LHS-LR006440
ACES Condition Code:	30
Defect Code:	

Service Instruction

Inspect the front safety belt part number (located on the label attached to the webbing at seat anchor point).

NAS vehicles: RH side front safety belt - 6G9N-61294-DHW

ROW vehicles: RH side front safety belt - 6G9N-61294-BGW

All vehicles: LH side front safety belt - 6G9N-61295-CGW

Replace both front safety belts and upper B-Pillar trim panels if they are earlier than the part numbers above. If the safety belts are the same or later than the part numbers above, only replace the B-Pillar trim panels.

- 1 . Install new front safety belts and upper B-Pillar trim panels (see Global Technical Reference GTR Workshop Manual, section 501-20A).
- 2 . Install new upper B-Pillar trim panels (see Global Technical Reference GTR Workshop Manual, section 501-05).

©2008 LandRover